

3 ct. OFF-SITE - VENDOR RETIRED		ECHOTEK: ECDR-GC814/8-FV2 ADC,8 CH,14 BIT,65MS/S,6U VME(TEV-BPM)			Data as of 06/15/2005	
Ptag #: 568846	sn: 013	MISJOB# 57818 /77266	10/04/2004	COMPLETED	ELS/EXPED	
06/29/2004	RETIRED	retire in equipdb and send back to vendor			retire in equipdb and send back to vendor	
Ptag #: 568847	sn: 014	MISJOB# 57134 /76103	10/06/2004	COMPLETED	ELS/EXPED	
07/23/2004	RETIRED	Echotek Corp. 555 Sparkman Dr., Ste 40 Huntsville. AL 35816 Attn: Ryan Scot RMA 1488 (256) 721-1911			Returned to vendor on MMT 6238	
Ptag #: 568848	sn: 017	MISJOB# 57818 /77265	10/04/2004	COMPLETED	ELS/EXPED	
09/30/2004	RETIRED	retire in equipdb and send back to vendor			retire in equipdb and send back to vendor	

1 ct. FCC/3/375
TESTING

ECHOTEK: ECDR-GC814/8-FV2R1

Data as of 06/15/2005

ADC,8 CH,14 BIT,65MS/S,6U VME,FW REV 1(TEV-BPM)

Ptag #: 568966	sn: 026	MISJOB# 57777 /77192	12/08/2004	COMPLETED	MAHLUM, RICHARD
01/26/2005	REPAIR	check	chl 2 is bad on the Histogram test.		Reprogrammed firmware.
			Chl 6 gain is low = 0.897		restests ok.
					Saved data files.
		MISJOB# 58713 /78905	05/09/2005	HOLD FOR INFORMATION	BARKER, WILLIAM
		burned IC on back of board, u24 + connector pins.	burned IC on back of board, u24 + connector pins.		burned IC on back of board, u24 + connector pins.

**146 ct. A0-SERV
ISSUED TO USER**

ECHOTEK: ECDR-GC814/8-FV2R2

Data as of 06/15/2005

ADC,8 CH,14 BIT,65MS/S,6U VME,FW REV 1,ECO1(TEV-BPM)

Ptag #: 569071 05/05/2005	sn: 148 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58040	/77631	11/24/2004	COMPLETED	MAHLUM, RICHARD
				check				reprogrammed firmware. tested and saved data files.
Ptag #: 569072 05/05/2005	sn: 125 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58910	/79303	02/23/2005	COMPLETED	BARKER, WILLIAM
				Install ECO				Replaced sync input resistor.
Ptag #: 568962 03/28/2005	sn: 049 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58040	/77632	11/24/2004	COMPLETED	MAHLUM, RICHARD
				check				reprogrammed firmware. tested and saved data files.
Ptag #: 568970 03/28/2005	sn: 030 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58910	/79304	02/23/2005	COMPLETED	BARKER, WILLIAM
				Install ECO				Replaced sync input resistor.
Ptag #: 568977 03/28/2005	sn: 065 ISSUED TO USER	OLSON	FL/AD	MISJOB# 57777	/77188	10/15/2004	COMPLETED	MAHLUM, RICHARD
				check		chl 2 - low gain = 0.897		all chls pass after limit adjustment is made in the Labview program. tested and saved data files
Ptag #: 568977 03/28/2005	sn: 065 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58278	/77960	12/17/2004	COMPLETED	MAHLUM, RICHARD
				Install new firmware				reprogrammed firmware. retests ok.
Ptag #: 568977 03/28/2005	sn: 065 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58910	/79288	02/23/2005	COMPLETED	BARKER, WILLIAM
				Install ECO				Replaced sync input resistor.
Ptag #: 568977 03/28/2005	sn: 065 ISSUED TO USER	OLSON	FL/AD	MISJOB# 57776	/77180	10/15/2004	COMPLETED	MAHLUM, RICHARD
				check		chl 2 gain is low = 0.896.		after the pass limits adjustment all chl pass. tested and saved data files
Ptag #: 568977 03/28/2005	sn: 065 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58278	/77963	12/17/2004	COMPLETED	MAHLUM, RICHARD
				Install new firmware				reprogrammed firmware. retests ok.
Ptag #: 568977 03/28/2005	sn: 065 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58910	/79289	02/23/2005	COMPLETED	BARKER, WILLIAM
				Install ECO				Replaced sync input resistor.
Ptag #: 568977 03/28/2005	sn: 065 ISSUED TO USER	OLSON	FL/AD	MISJOB# 57831	/77286	10/07/2004	COMPLETED	MAHLUM, RICHARD
				check				tested with Labview and saved data files.
Ptag #: 568977 03/28/2005	sn: 065 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58278	/77965	12/20/2004	COMPLETED	MAHLUM, RICHARD
				Install new firmware				reprogrammed firmware. retests ok.
Ptag #: 568977 03/28/2005	sn: 065 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58908	/79277	02/23/2005	COMPLETED	BARKER, WILLIAM
				Install ECO				Replaced sync input resistor.

Ptag #: 568978		sn: 070		FL/AD	MISJOB# 57831	/77287	10/07/2004	COMPLETED	MAHLUM, RICHARD
03/28/2005	ISSUED TO USER	OLSON			check				tested with Labview and saved data files.
					MISJOB# 58278	/77966	12/20/2004	COMPLETED	MAHLUM, RICHARD
					Install new firmware				reprogrammed firmware.
					MISJOB# 58908	/79278	02/23/2005	COMPLETED	retests ok.
					Install ECO				BARKER, WILLIAM
									Replaced sync input resistor.
Ptag #: 568980		sn: 075		FL/AD	MISJOB# 57831	/77289	10/15/2004	COMPLETED	MAHLUM, RICHARD
03/28/2005	ISSUED TO USER	OLSON			check				one chl has low gain
									all chls pass after limit adjustment is made in the
									Labview program.
					MISJOB# 58278	/77968	12/20/2004	COMPLETED	tested and saved data files
					Install new firmware				MAHLUM, RICHARD
									reprogrammed firmware.
					MISJOB# 58908	/79279	02/23/2005	COMPLETED	retests ok.
					Install ECO				BARKER, WILLIAM
									Replaced sync input resistor.

A2-SERV

Ptag #: 568964		sn: 031		FL/AD	MISJOB# 57777	/77190	12/10/2004	COMPLETED	MAHLUM, RICHARD
02/18/2005	ISSUED TO USER	OLSON			check		chl 3 - bad DNL		tested with Labview and saved data files.
									rcvd 12/2/04
					MISJOB# 58817	/79013	02/14/2005	COMPLETED	retests ok - saved solder shorts
					install eoc				BARKER, WILLIAM
									Replaced sync output resistor.
Ptag #: 569008		sn: 054		FL/AD	MISJOB# 57924	/77438	12/07/2004	COMPLETED	MAHLUM, RICHARD
02/18/2005	ISSUED TO USER	OLSON			check				bad raw adc on chl 7 but ok after power cycling.
									Reprogrammed firmware.
					MISJOB# 58817	/79014	02/14/2005	COMPLETED	retested and saved data files.
					install eoc				BARKER, WILLIAM
									Replaced sync output resistor.
Ptag #: 569017		sn: 091		FL/AD	MISJOB# 57924	/77447	12/10/2004	COMPLETED	MAHLUM, RICHARD
02/18/2005	ISSUED TO USER	OLSON			check		factory repair solder shorts		ch2 fails DNL
									ch4 bad raw ADC but OK after reboot
									rcvd 12/2/04
					MISJOB# 58817	/79016	02/14/2005	COMPLETED	retests ok - saved data files
					install eoc				BARKER, WILLIAM
									Replaced sync output resistor.
Ptag #: 569018		sn: 102		FL/AD	MISJOB# 57924	/77448	12/07/2004	COMPLETED	MAHLUM, RICHARD
02/18/2005	ISSUED TO USER	OLSON			check				ch 5 low gain
									ch 6 raw ADC bad but OK after reboot
									Reprogrammed firmware.
					MISJOB# 58817	/79017	02/14/2005	COMPLETED	retested and saved data files.
					install eoc				BARKER, WILLIAM
									Replaced sync output resistor.

Ptag #:	569039	sn:	152			MISJOB# 57994	/77540	11/22/2004	COMPLETED	MAHLUM, RICHARD
02/18/2005	ISSUED TO USER	OLSON	FL/AD			check				reprogrammed firmware.
						MISJOB# 58817	/79018	02/14/2005	COMPLETED	tested and saved data files.
						install eoc				BARKER, WILLIAM
										Replaced sync output resistor.

A3-SERV

Ptag #:	568972	sn:	037			MISJOB# 57776	/77182	09/29/2004	COMPLETED	MAHLUM, RICHARD
11/16/2004	ISSUED TO USER	OLSON	FL/AD			check				tested
Ptag #:	568989	sn:	040			MISJOB# 57831	/77298	10/06/2004	COMPLETED	MAHLUM, RICHARD
11/16/2004	ISSUED TO USER	OLSON	FL/AD			check				tested with Labview and saved data files.
Ptag #:	568992	sn:	061			MISJOB# 57831	/77301	10/06/2004	COMPLETED	MAHLUM, RICHARD
11/16/2004	ISSUED TO USER	OLSON	FL/AD			check				tested with Labview and saved data files.
Ptag #:	569045	sn:	130			MISJOB# 57994	/77546	12/01/2004	COMPLETED	MAHLUM, RICHARD
12/02/2004	ISSUED TO USER	OLSON	FL/AD			check				reprogrammed firmware.
										tested and saved data files.

A4-SERV

Ptag #:	568899	sn:	039			MISJOB# 57777	/77186	10/15/2004	COMPLETED	MAHLUM, RICHARD
03/23/2005	ISSUED TO USER	OLSON	FL/AD			check		Chl 6 - low gain = 0.899		all chls pass after limit adjustment is made in the
										Labview program.
						MISJOB# 58278	/77959	12/20/2004	COMPLETED	tested and saved data files
						Install new firmware				MAHLUM, RICHARD
										reprogrammed firmware.
						MISJOB# 58908	/79272	02/23/2005	COMPLETED	retests ok.
						Install ECO				BARKER, WILLIAM
										Replaced sync input resistor.
Ptag #:	568900	sn:	035			MISJOB# 57777	/77187	12/08/2004	COMPLETED	MAHLUM, RICHARD
03/23/2005	ISSUED TO USER	OLSON	FL/AD			check		chl 4 - bad raw ADC in Histogram test		Reprogrammed firmware.
								chl 7 - low gain = 0.897		retests ok.
										Saved data files.
						MISJOB# 58878	/79171	02/18/2005	COMPLETED	BARKER, WILLIAM
						check				Replaced sync input resistor.
Ptag #:	568965	sn:	051			MISJOB# 57777	/77191	09/29/2004	COMPLETED	MAHLUM, RICHARD
03/23/2005	ISSUED TO USER	OLSON	FL/AD			check				tested with Labview and saved data files
						MISJOB# 58278	/77961	12/20/2004	COMPLETED	MAHLUM, RICHARD
						Install new firmware				reprogrammed firmware.
										retests ok.
						MISJOB# 58908	/79273	02/23/2005	COMPLETED	BARKER, WILLIAM
						Install ECO				Replaced sync input resistor.

Ptag #: 568967 03/23/2005	sn: 048 ISSUED TO USER	OLSON	FL/AD	MISJOB# 57776	/77177	09/29/2004	COMPLETED	MAHLUM, RICHARD
				check				tested with Labview and saved data files.
				MISJOB# 58278	/77962	12/20/2004	COMPLETED	MAHLUM, RICHARD
				Install new firmware				reprogrammed firmware.
								retests ok.
				MISJOB# 58908	/79274	02/23/2005	COMPLETED	BARKER, WILLIAM
				Install ECO				Replaced sync input resistor.
Ptag #: 568976 03/23/2005	sn: 043 ISSUED TO USER	OLSON	FL/AD	MISJOB# 57775	/77176	10/15/2004	COMPLETED	MAHLUM, RICHARD
				check		chl 1 - low gain = 0.897		all chls pass after limit adjustment is made in the
								Labview program.
				MISJOB# 58278	/77964	12/20/2004	COMPLETED	tested and saved data files
				Install new firmware				MAHLUM, RICHARD
								reprogrammed firmware.
								retests ok.
				MISJOB# 58908	/79276	02/23/2005	COMPLETED	BARKER, WILLIAM
				Install ECO				Replaced sync input resistor.

B0

Ptag #: 569040 02/18/2005	sn: 121 ISSUED TO USER	OLSON	FL/AD	MISJOB# 57994	/77541	11/22/2004	COMPLETED	MAHLUM, RICHARD
				check				reprogrammed firmware.
								tested and saved data files.
				MISJOB# 58817	/79019	02/14/2005	COMPLETED	BARKER, WILLIAM
				install eoc				Replaced sync output resistor.
Ptag #: 569059 02/18/2005	sn: 132 ISSUED TO USER	OLSON	FL/AD	MISJOB# 57994	/77560	11/15/2004	COMPLETED	MAHLUM, RICHARD
				check				reprogrammed with latest firmware.
								tested and collected data files.
				MISJOB# 58817	/79020	02/14/2005	COMPLETED	BARKER, WILLIAM
				install eoc				Replaced sync output resistor.
Ptag #: 569060 02/18/2005	sn: 059 ISSUED TO USER	OLSON	FL/AD	MISJOB# 57994	/77561	11/15/2004	COMPLETED	MAHLUM, RICHARD
				check				reprogrammed with latest firmware.
								tested and collected data files.
				MISJOB# 58817	/79021	02/14/2005	COMPLETED	BARKER, WILLIAM
				install eoc				Replaced sync output resistor.

B1-SERV

Ptag #: 568982 03/28/2005	sn: 027 ISSUED TO USER	OLSON	FL/AD	MISJOB# 57831	/77291	12/14/2004	COMPLETED	MAHLUM, RICHARD
				check				chl 6 fails DNL
								reprogrammed firmware.
								retests ok.
								Saved data files to server.
				MISJOB# 58878	/79173	02/18/2005	COMPLETED	BARKER, WILLIAM
				check				Replaced sync input resistor.

Ptag #: 568990 sn: 038 03/28/2005 ISSUED TO USER OLSON FL/AD				MISJOB# 57831 /77299 check	10/15/2004	COMPLETED	MAHLUM, RICHARD low gain on three channels all chls pass after limit adjustment is made in the Labview program. tested and saved data files
				MISJOB# 58278 /77973 Install new firmware	12/20/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. retests ok.
				MISJOB# 58908 /79282 Install ECO	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 568993 sn: 042 03/28/2005 ISSUED TO USER OLSON FL/AD				MISJOB# 57831 /77302 check	10/15/2004	COMPLETED	MAHLUM, RICHARD low gain on two channels. all chls pass after limit adjustment is made in the Labview program. tested and saved data files
				MISJOB# 58278 /77975 Install new firmware	12/14/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware and tested. saved new gains to spreadsheet.
				MISJOB# 58878 /79178 check	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 568994 sn: 041 03/28/2005 ISSUED TO USER OLSON FL/AD				MISJOB# 57831 /77303 check	10/15/2004	COMPLETED	MAHLUM, RICHARD low gain on two channels all chls pass after limit adjustment is made in the Labview program. tested and saved data files
				MISJOB# 58278 /77976 Install new firmware	12/14/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware and tested. saved new gains to spreadsheet.
				MISJOB# 58878 /79179 check	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 569031 sn: 147 03/28/2005 ISSUED TO USER OLSON FL/AD				MISJOB# 57994 /77532 check	12/03/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested and saved data files.
				MISJOB# 58910 /79291 Install ECO	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.

B2-SERV

Ptag #: 568898 sn: 046 03/15/2005 ISSUED TO USER OLSON FL/AD				MISJOB# 57777 /77185 check	12/08/2004 Chl 4 - bad raw ADC in Histogram test	COMPLETED	MAHLUM, RICHARD Reprogrammed firmware. retests ok. Saved data files.
				MISJOB# 58711 /78903 u24, on bottom-burned	03/03/2005 u24, on bottom-burned	COMPLETED	BARKER, WILLIAM U24 replaced by vendor. Tested with LabVIEW, saved data files to server. chl 7 fails DNL.

Ptag #: 568975 03/15/2005	sn: 047 ISSUED TO USER	OLSON	FL/AD	MISJOB# 57775 /77175 check	09/29/2004	COMPLETED	MAHLUM, RICHARD tested
				MISJOB# 58952 /79409 install sync eco and run labview tests	03/03/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server. Replaced sync input resistor.
Ptag #: 568985 03/15/2005	sn: 025 ISSUED TO USER	OLSON	FL/AD	MISJOB# 57831 /77294 check	10/18/2004	COMPLETED	MAHLUM, RICHARD low gain on two chls all chls pass after adjusting the limits in the Labview program
				MISJOB# 58278 /77970 Install new firmware	12/15/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. retested ok.
				MISJOB# 58878 /79174 check	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 568986 03/15/2005	sn: 044 ISSUED TO USER	OLSON	FL/AD	MISJOB# 57831 /77295 check	10/18/2004	COMPLETED	MAHLUM, RICHARD low gain on 4 all chls pass after adjusting the limits in the Labview program
				MISJOB# 58278 /77971 Install new firmware	12/15/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. retested ok.
				MISJOB# 58878 /79175 check	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 568988 03/15/2005	sn: 087 ISSUED TO USER	OLSON	FL/AD	MISJOB# 57831 /77297 check	10/06/2004	COMPLETED	MAHLUM, RICHARD tested with Labview and saved data files.
				MISJOB# 58278 /77972 Install new firmware	12/15/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. retested ok.
				MISJOB# 58878 /79176 check	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.

B3-SERV

Ptag #: 569099 02/01/2005	sn: 158 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58086 /77708 check	11/19/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested and saved data files.
				MISJOB# 58086 /77709 check	11/19/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested and saved data files.
Ptag #: 569100 02/01/2005	sn: 141 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58085 /77700 check	11/19/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested and saved data files.
				MISJOB# 58085 /77701 check	11/19/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested and saved data files.

B4-SERV

Ptag #: 568984		sn: 085		FL/AD	MISJOB# 57831	/77293	12/14/2004	COMPLETED	MAHLUM, RICHARD
03/23/2005	ISSUED TO USER	OLSON			check				chl 7 fails DNL reprogrammed firmware. retests ok. Saved data files to server.
					MISJOB# 58908	/79280	02/23/2005	COMPLETED	BARKER, WILLIAM
					Install ECO				Replaced sync input resistor.
Ptag #: 568987		sn: 034		FL/AD	MISJOB# 57831	/77296	12/13/2004	COMPLETED	MAHLUM, RICHARD
03/23/2005	ISSUED TO USER	OLSON			check				low gain on four channels. reprogrammed firmware. retested ok. saved data files.
					MISJOB# 58908	/79281	02/23/2005	COMPLETED	BARKER, WILLIAM
					Install ECO				Replaced sync input resistor.
Ptag #: 568997		sn: 103		FL/AD	MISJOB# 58278	/77989	11/24/2004	CANCELED BY ESS	
03/23/2005	ISSUED TO USER	OLSON			Install new firmware				
					MISJOB# 57924	/77427	10/25/2004	COMPLETED	MAHLUM, RICHARD
					check				tested and saved data files.
					MISJOB# 58278	/77979	12/15/2004	COMPLETED	MAHLUM, RICHARD
					Install new firmware				reprogrammed firmware. retested ok.
					MISJOB# 58878	/79182	02/18/2005	COMPLETED	BARKER, WILLIAM
					check				Replaced sync input resistor.
Ptag #: 568998		sn: 107		FL/AD	MISJOB# 58278	/77990	11/24/2004	CANCELED BY ESS	
03/23/2005	ISSUED TO USER	OLSON			Install new firmware				
					MISJOB# 57924	/77428	10/25/2004	COMPLETED	MAHLUM, RICHARD
					check				tested and saved data files.
					MISJOB# 58278	/77980	12/15/2004	COMPLETED	MAHLUM, RICHARD
					Install new firmware				reprogrammed firmware. retested ok.
					MISJOB# 58878	/79183	02/18/2005	COMPLETED	BARKER, WILLIAM
					check				Replaced sync input resistor.
Ptag #: 569013		sn: 089		FL/AD	MISJOB# 57924	/77443	12/09/2004	COMPLETED	MAHLUM, RICHARD
03/23/2005	ISSUED TO USER	OLSON			check				bad DNL on chl 1 rcvd rep 12/2/04 factory fixed solder shorts. retest ok. saved data files.
					MISJOB# 58878	/79189	02/18/2005	COMPLETED	BARKER, WILLIAM
					check				Replaced sync input resistor.

C1-SERV

Ptag #: 569032		sn: 124		FL/AD	MISJOB# 57994	/77533	12/03/2004	COMPLETED	MAHLUM, RICHARD
03/28/2005	ISSUED TO USER	OLSON			check				reprogrammed firmware. tested and saved data files.
					MISJOB# 58910	/79292	02/23/2005	COMPLETED	BARKER, WILLIAM
					Install ECO				Replaced sync input resistor.

Ptag #: 569037 03/28/2005	sn: 149 ISSUED TO USER	OLSON	FL/AD	MISJOB# 57994	/77538	11/29/2004	COMPLETED	MAHLUM, RICHARD
				check				reprogrammed firmware. tested and saved data files.
				MISJOB# 58910	/79295	02/23/2005	COMPLETED	BARKER, WILLIAM
				Install ECO				Replaced sync input resistor.
Ptag #: 569038 03/28/2005	sn: 106 ISSUED TO USER	OLSON	FL/AD	MISJOB# 57994	/77539	11/29/2004	COMPLETED	MAHLUM, RICHARD
				check				reprogrammed firmware. tested and saved data files.
				MISJOB# 58910	/79296	02/23/2005	COMPLETED	BARKER, WILLIAM
				Install ECO				Replaced sync input resistor.
Ptag #: 569075 03/28/2005	sn: 157 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58040	/77635	11/24/2004	COMPLETED	MAHLUM, RICHARD
				check				reprogrammed firmware. tested and saved data files.
				MISJOB# 58910	/79306	02/23/2005	COMPLETED	BARKER, WILLIAM
				Install ECO				Replaced sync input resistor.
Ptag #: 569076 03/28/2005	sn: 095 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58040	/77636	11/24/2004	COMPLETED	MAHLUM, RICHARD
				check				reprogrammed firmware. tested and saved data files.
				MISJOB# 58910	/79307	02/23/2005	COMPLETED	BARKER, WILLIAM
				Install ECO				Replaced sync input resistor.

C2-SERV

Ptag #: 568995 03/15/2005	sn: 063 ISSUED TO USER	OLSON	FL/AD	MISJOB# 57831	/77304	10/18/2004	COMPLETED	MAHLUM, RICHARD
				check				low gain on four chls all chls pass after revising program limits
				MISJOB# 58278	/77977	12/16/2004	COMPLETED	MAHLUM, RICHARD
				Install new firmware				reprogrammed firmware. retests ok.
				MISJOB# 58878	/79180	02/18/2005	COMPLETED	BARKER, WILLIAM
				check				Replaced sync input resistor.
Ptag #: 568996 03/15/2005	sn: 052 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58278	/77988	11/24/2004	CANCELED BY ESS	
				Install new firmware				
				MISJOB# 57831	/77305	10/18/2004	COMPLETED	MAHLUM, RICHARD
				check				low gain on 2, 5 and 6 all chls pass after revising the program limits.
				MISJOB# 58278	/77978	12/16/2004	COMPLETED	MAHLUM, RICHARD
				Install new firmware				reprogrammed firmware. retests ok.
				MISJOB# 58878	/79181	02/18/2005	COMPLETED	BARKER, WILLIAM
				check				Replaced sync input resistor.

Ptag #: 568999 03/15/2005	sn: 111 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58278 /77991	11/24/2004	CANCELED BY ESS	
				Install new firmware			
				MISJOB# 57924 /77429	10/21/2004	COMPLETED	MAHLUM, RICHARD tests ok . saved data files.
				MISJOB# 58278 /77981	12/16/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. retests ok.
				MISJOB# 58878 /79184	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.

Ptag #: 569000 03/15/2005	sn: 071 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58278 /77992	11/24/2004	CANCELED BY ESS	
				Install new firmware			
				MISJOB# 57924 /77430	10/21/2004	COMPLETED	MAHLUM, RICHARD tests ok . saved data files.
				MISJOB# 58278 /77982	12/16/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. retests ok.
				MISJOB# 58878 /79185	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.

Ptag #: 569131 03/30/2005	sn: 179 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58238 /77902	01/13/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
				MISJOB# 58910 /79329	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.

C3-SERV

Ptag #: 569042 02/01/2005	sn: 110 ISSUED TO USER	OLSON	FL/AD	MISJOB# 57994 /77543	12/06/2004	COMPLETED	MAHLUM, RICHARD retested after failing Raw ADC. reprogrammed firmware. tested and saved data files.
-------------------------------------	---------------------------	-------	-------	----------------------	------------	-----------	--

Ptag #: 569055 02/01/2005	sn: 094 ISSUED TO USER	OLSON	FL/AD	MISJOB# 57994 /77556	11/22/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested and saved data files.
-------------------------------------	---------------------------	-------	-------	----------------------	------------	-----------	---

Ptag #: 570226 04/27/2005	sn: 204 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58335 /78133	01/27/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
				MISJOB# 58865 /79094	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.

Ptag #: 570227 04/27/2005	sn: 210 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58335 /78134	01/27/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
				MISJOB# 58865 /79095	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.

C4-SERV

Ptag #: 569020		sn: 069	OLSON	FL/AD	MISJOB# 57924	/77450	12/09/2004	COMPLETED	MAHLUM, RICHARD
03/23/2005	ISSUED TO USER				check				ch 2 fails DNL rcvd 12/2/04 factory fixed solder shorts. retest ok. saved data files.
					MISJOB# 58878	/79194	02/18/2005	COMPLETED	BARKER, WILLIAM
					check				Replaced sync input resistor.
Ptag #: 569021		sn: 100	OLSON	FL/AD	MISJOB# 57924	/77451	10/21/2004	COMPLETED	MAHLUM, RICHARD
03/23/2005	ISSUED TO USER				check				tests ok . saved data files.
					MISJOB# 58278	/78004	12/20/2004	COMPLETED	MAHLUM, RICHARD
					Install new firmware				reprogrammed firmware. retests ok.
					MISJOB# 58908	/79284	02/23/2005	COMPLETED	BARKER, WILLIAM
					Install ECO				Replaced sync input resistor.
Ptag #: 569022		sn: 060	OLSON	FL/AD	MISJOB# 57924	/77452	10/21/2004	COMPLETED	MAHLUM, RICHARD
03/23/2005	ISSUED TO USER				check				tests ok . saved data files.
					MISJOB# 58278	/78005	12/20/2004	COMPLETED	MAHLUM, RICHARD
					Install new firmware				reprogrammed firmware. retests ok.
					MISJOB# 58908	/79285	02/23/2005	COMPLETED	BARKER, WILLIAM
					Install ECO				Replaced sync input resistor.
Ptag #: 569027		sn: 056	OLSON	FL/AD	MISJOB# 57924	/77457	12/06/2004	COMPLETED	MAHLUM, RICHARD
03/23/2005	ISSUED TO USER				check				failed - bad Raw ADC. reprogrammed firmware. tested and saved data files.
					MISJOB# 58278	/78008	12/20/2004	COMPLETED	MAHLUM, RICHARD
					Install new firmware				reprogrammed firmware. retests ok.
					MISJOB# 58878	/79197	02/18/2005	COMPLETED	BARKER, WILLIAM
					check				Replaced sync input resistor.
Ptag #: 569049		sn: 151	OLSON	FL/AD	MISJOB# 57994	/77550	12/06/2004	COMPLETED	MAHLUM, RICHARD
03/23/2005	ISSUED TO USER				check				reprogrammed firmware. tested and saved data files.
					MISJOB# 58878	/79201	02/18/2005	COMPLETED	BARKER, WILLIAM
					check				Replaced sync input resistor.

D0

Ptag #: 569063		sn: 127	OLSON	FL/AD	MISJOB# 58036	/77623	11/19/2004	COMPLETED	MAHLUM, RICHARD
02/18/2005	ISSUED TO USER				check				reprogrammed firmware. tested and saved data files.
					MISJOB# 58817	/79022	02/14/2005	COMPLETED	BARKER, WILLIAM
					install eoc				Replaced sync output resistor.

Ptag #: 569064 02/18/2005	sn: 093 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58036	/77624	11/19/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested and saved data files. BARKER, WILLIAM Replaced sync output resistor.
				check				
Ptag #: 569065 02/18/2005	sn: 169 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58817	/79023	02/14/2005	COMPLETED	BARKER, WILLIAM Replaced sync output resistor.
				install eoc				
Ptag #: 569065 02/18/2005	sn: 169 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58036	/77625	11/19/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested and saved data files. BARKER, WILLIAM Replaced sync output resistor.
				check				
Ptag #: 569065 02/18/2005	sn: 169 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58817	/79024	02/14/2005	COMPLETED	BARKER, WILLIAM Replaced sync output resistor.
				install eoc				

D1-SERV

Ptag #: 569015 03/15/2005	sn: 079 ISSUED TO USER	OLSON	FL/AD	MISJOB# 57924	/77445	10/15/2004	COMPLETED	MAHLUM, RICHARD low gain on chl 6 All chls pass after the programs pass limits were adjusted. Recaptured data files and saved.
				check				
Ptag #: 569083 03/28/2005	sn: 162 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58278	/78001	12/17/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. retests ok.
				Install new firmware				
Ptag #: 569083 03/28/2005	sn: 162 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58878	/79191	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
				check				
Ptag #: 569083 03/28/2005	sn: 162 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58041	/77643	11/30/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested and saved data files. BARKER, WILLIAM Replaced sync input resistor.
				check				
Ptag #: 569084 03/28/2005	sn: 174 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58910	/79314	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
				Install ECO				
Ptag #: 569084 03/28/2005	sn: 174 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58041	/77644	11/30/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested and saved data files. BARKER, WILLIAM Replaced sync input resistor.
				check				
Ptag #: 569089 03/28/2005	sn: 076 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58910	/79315	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
				Install ECO				
Ptag #: 569089 03/28/2005	sn: 076 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58042	/77649	11/24/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested and saved data files. BARKER, WILLIAM Replaced sync input resistor.
				check				
Ptag #: 569089 03/28/2005	sn: 076 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58910	/79319	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
				Install ECO				
Ptag #: 569090 03/28/2005	sn: 101 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58042	/77650	11/24/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested and saved data files. BARKER, WILLIAM Replaced sync input resistor.
				check				
Ptag #: 569090 03/28/2005	sn: 101 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58910	/79320	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
				Install ECO				
Ptag #: 569127 03/28/2005	sn: 206 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58238	/77898	01/13/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
				run tests				
Ptag #: 569127 03/28/2005	sn: 206 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58910	/79327	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
				Install ECO				

D2-SERV

Ptag #: 569012 03/15/2005	sn: 067 ISSUED TO USER	OLSON	FL/AD	MISJOB# 57924 /77442	12/07/2004	COMPLETED	MAHLUM, RICHARD bad Raw ADC on chls 2, 3 and 4 after successive power cycles. Reprogrammed firmware. retested and saved date files.
				check			
				MISJOB# 58817 /79015	02/14/2005	COMPLETED	BARKER, WILLIAM Replaced sync output resistor.
				install eoc			
Ptag #: 569086 03/15/2005	sn: 142 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58042 /77646	03/03/2005 chl 7 fails DNL.	COMPLETED	BARKER, WILLIAM CH7 now passes DNL. Tested with LabVIEW, saved data files to server. Replaced sync input resistor.
				check			
Ptag #: 569091 03/15/2005	sn: 139 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58042 /77651	11/22/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested and saved data files.
				check			
				MISJOB# 58817 /79028	02/14/2005	COMPLETED	BARKER, WILLIAM Replaced sync output resistor.
				install eoc			
Ptag #: 569098 03/15/2005	sn: 165 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58086 /77707	11/19/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested and saved data files.
				check			
				MISJOB# 58817 /79029	02/14/2005	COMPLETED	BARKER, WILLIAM Replaced sync output resistor.
				install eoc			

D3-SERV

Ptag #: 569061 02/01/2005	sn: 134 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58036 /77617	11/15/2004	COMPLETED	MAHLUM, RICHARD reprogrammed with latest firmware. tested and collected data files.
				check			
Ptag #: 569062 02/01/2005	sn: 154 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58036 /77622	11/15/2004	COMPLETED	MAHLUM, RICHARD reprogrammed with latest firmware. tested and collected data files.
				check			
Ptag #: 569067 02/01/2005	sn: 145 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58036 /77627	11/16/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested with Labview and saved data files.
				check			
Ptag #: 569068 02/01/2005	sn: 170 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58036 /77628	11/16/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested with Labview and saved data files.
				check			

D4-SERV

Ptag #: 569050 03/23/2005	sn: 155 ISSUED TO USER	OLSON	FL/AD	MISJOB# 57994 /77551	12/06/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested and saved data files.
				check			
				MISJOB# 58878 /79202	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
				check			

Ptag #: 569058 03/23/2005	sn: 104 ISSUED TO USER	OLSON	FL/AD	MISJOB# 57994 check	/77559	12/08/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested and saved data files. chl 6 fails DNL removed solder short on ic UG2, pins27-28. retests ok.
				MISJOB# 58878 check	/79203	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 569087 03/23/2005	sn: 133 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58042 check	/77647	11/24/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested and saved data files.
				MISJOB# 58910 Install ECO	/79317	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 569088 04/23/2005	sn: 058 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58042 check	/77648	11/24/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested and saved data files.
				MISJOB# 58910 Install ECO	/79318	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 570237 03/23/2005	sn: 191 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58335 Check	/78128	01/26/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
				MISJOB# 58865 Install ECO	/79104	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.

E1-SERV

Ptag #: 569128 03/28/2005	sn: 117 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58238 run tests	/77899	01/13/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
				MISJOB# 58910 Install ECO	/79328	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 569132 03/28/2005	sn: 181 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58238 run tests	/77903	01/13/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
				MISJOB# 58910 Install ECO	/79330	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 569133 03/28/2005	sn: 198 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58238 run tests	/77904	01/13/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
				MISJOB# 58910 Install ECO	/79331	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 569138 03/28/2005	sn: 185 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58238 run tests	/77909	12/27/2004	COMPLETED	MAHLUM, RICHARD tested with Labview. saved data files to server.
				MISJOB# 58910 Install ECO	/79334	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.

Ptag #: 569103 02/15/2005	sn: 160 ISSUED TO USER	OLSON	FL/AD/TEV	MISJOB# 58086	/77712	11/19/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested and saved data files. BARKER, WILLIAM Replaced sync output resistor.
				check				
Ptag #: 569104 02/15/2005	sn: 167 ISSUED TO USER	OLSON	FL/AD/TEV	MISJOB# 58817	/79032	02/14/2005	COMPLETED	BARKER, WILLIAM Replaced sync output resistor.
				install eoc				
Ptag #: 569104 02/15/2005	sn: 167 ISSUED TO USER	OLSON	FL/AD/TEV	MISJOB# 58086	/77713	11/19/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested and saved data files. BARKER, WILLIAM Replaced sync output resistor.
				check				
Ptag #: 569104 02/15/2005	sn: 167 ISSUED TO USER	OLSON	FL/AD/TEV	MISJOB# 58817	/79033	02/14/2005	COMPLETED	BARKER, WILLIAM Replaced sync output resistor.
				install eoc				

E4-SERV

Ptag #: 570256 03/23/2005	sn: 219 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58335	/78115	01/26/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
				Check				
Ptag #: 570257 03/23/2005	sn: 231 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58865	/79107	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
				Install ECO				
Ptag #: 570257 03/23/2005	sn: 231 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58335	/78116	01/26/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
				Check				
Ptag #: 570257 03/23/2005	sn: 231 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58865	/79108	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
				Install ECO				
Ptag #: 570305 03/23/2005	sn: 274 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58382	/78235	02/01/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
				check				
Ptag #: 570305 03/23/2005	sn: 274 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58865	/79123	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
				Install ECO				
Ptag #: 570306 03/23/2005	sn: 254 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58382	/78236	02/01/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
				check				
Ptag #: 570306 03/23/2005	sn: 254 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58865	/79124	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
				Install ECO				
Ptag #: 570321 03/23/2005	sn: 265 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58450	/78359	02/01/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
				check				
Ptag #: 570321 03/23/2005	sn: 265 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58865	/79137	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
				Install ECO				
Ptag #: 570322 03/23/2005	sn: 242 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58450	/78360	02/01/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
				check				
Ptag #: 570322 03/23/2005	sn: 242 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58865	/79138	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
				Install ECO				

F1-SERV

Ptag #: 569014 sn: 080				MISJOB# 57924 /77444	10/15/2004	COMPLETED	MAHLUM, RICHARD
05/05/2005	ISSUED TO USER	OLSON	FL/AD	check			tested and saved data files
				MISJOB# 58278 /78000	12/17/2004	COMPLETED	MAHLUM, RICHARD
				Install new firmware			reprogrammed firmware.
				MISJOB# 58878 /79190	02/18/2005	COMPLETED	retests ok.
				check			BARKER, WILLIAM
							Replaced sync input resistor.
Ptag #: 569016 sn: 057				MISJOB# 57924 /77446	10/15/2004	COMPLETED	MAHLUM, RICHARD
04/05/2005	ISSUED TO USER	OLSON	FL/AD	check			tested and saved data files
				MISJOB# 58278 /78002	12/17/2004	COMPLETED	MAHLUM, RICHARD
				Install new firmware			reprogrammed firmware.
				MISJOB# 58878 /79192	02/18/2005	COMPLETED	retests ok.
				check			BARKER, WILLIAM
							Replaced sync input resistor.
Ptag #: 569035 sn: 114				MISJOB# 57994 /77536	12/06/2004	COMPLETED	MAHLUM, RICHARD
04/05/2005	ISSUED TO USER	OLSON	FL/AD	check			reprogrammed firmware.
				MISJOB# 58878 /79199	02/18/2005	COMPLETED	tested and saved data files.
				check			BARKER, WILLIAM
							Replaced sync input resistor.
Ptag #: 569036 sn: 055				MISJOB# 57994 /77537	12/06/2004	COMPLETED	MAHLUM, RICHARD
04/05/2005	ISSUED TO USER	OLSON	FL/AD	check			reprogrammed firmware.
				MISJOB# 58878 /79200	02/18/2005	COMPLETED	tested and saved data files.
				check			BARKER, WILLIAM
							Replaced sync input resistor.
Ptag #: 569123 sn: 115				MISJOB# 58238 /77894	01/12/2005	COMPLETED	BARKER, WILLIAM
04/05/2005	ISSUED TO USER	OLSON	FL/AD	run tests			Tested with LabVIEW, saved data files to server.
				MISJOB# 58817 /79034	02/14/2005	COMPLETED	BARKER, WILLIAM
				install eoc			Replaced sync output resistor.
Ptag #: 569124 sn: 119				MISJOB# 58238 /77895	01/12/2005	COMPLETED	BARKER, WILLIAM
04/05/2005	ISSUED TO USER	OLSON	FL/AD	run tests			Tested with LabVIEW, saved data files to server.
				MISJOB# 58817 /79035	02/14/2005	COMPLETED	BARKER, WILLIAM
				install eoc			Replaced sync output resistor.

F2-SERV

Ptag #: 569066 sn: 171				MISJOB# 58036 /77626	11/19/2004	COMPLETED	MAHLUM, RICHARD
02/18/2005	ISSUED TO USER	OLSON	FL/AD	check			reprogrammed firmware.
				MISJOB# 58817 /79025	02/14/2005	COMPLETED	tested and saved data files.
				install eoc			BARKER, WILLIAM
							Replaced sync output resistor.
Ptag #: 569069 sn: 173				MISJOB# 58040 /77629	11/19/2004	COMPLETED	MAHLUM, RICHARD
02/18/2005	ISSUED TO USER	OLSON	FL/AD	check			reprogrammed firmware.
				MISJOB# 58817 /79026	02/14/2005	COMPLETED	tested and saved data files.
				install eoc			BARKER, WILLIAM
							Replaced sync output resistor.

Ptag #:	569070	sn: 168	02/18/2005	ISSUED TO USER	OLSON	FL/AD	MISJOB# 58040	/77630	11/19/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested and saved data files.
							check				
							MISJOB# 58817	/79027	02/14/2005	COMPLETED	BARKER, WILLIAM Replaced sync output resistor.
							install eoc				
Ptag #:	569140	sn: 194	02/18/2005	ISSUED TO USER	OLSON	FL/AD	MISJOB# 58238	/77911	01/12/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
							run tests				
							MISJOB# 58817	/79038	02/10/2005	COMPLETED	BLEDSON, STEWART Removed and replaced R242 with a 50 ohm 0402 resistor.
							install eoc				
Ptag #:	569141	sn: 184	02/18/2005	ISSUED TO USER	OLSON	FL/AD	MISJOB# 58238	/77912	01/12/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
							run tests				
							MISJOB# 58817	/79039	02/10/2005	COMPLETED	BLEDSON, STEWART Removed and replaced R242 with a 50 ohm 0402 resistor.
							install eoc				

F23-SERV

Ptag #:	570222	sn: 218	05/20/2005	ISSUED TO USER	EDDY	FL/AD	MISJOB# 58335	/78129	01/27/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
							Check				
							MISJOB# 58865	/79090	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
							Install ECO				
Ptag #:	570223	sn: 221	05/20/2005	ISSUED TO USER	EDDY	FL/AD	MISJOB# 58335	/78130	01/27/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
							Check				
							MISJOB# 58865	/79091	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
							Install ECO				
Ptag #:	570260	sn: 228	05/20/2005	ISSUED TO USER	EDDY	FL/AD	MISJOB# 58335	/78119	01/26/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
							Check				
							MISJOB# 58865	/79111	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
							Install ECO				
Ptag #:	570261	sn: 224	05/20/2005	ISSUED TO USER	EDDY	FL/AD	MISJOB# 58335	/78120	01/26/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
							Check				
							MISJOB# 58865	/79112	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
							Install ECO				

F3-SERV

Ptag #:	570232	sn: 268	04/05/2005	ISSUED TO USER	OLSON	FL/AD	MISJOB# 58335	/78123	01/26/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
							Check				
							MISJOB# 58865	/79099	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
							Install ECO				
Ptag #:	570233	sn: 246	04/05/2005	ISSUED TO USER	OLSON	FL/AD	MISJOB# 58335	/78124	01/26/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
							Check				
							MISJOB# 58865	/79100	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
							Install ECO				

Ptag #: 570234 04/05/2005	sn: 230 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58335	/78125	01/26/2005	COMPLETED	BARKER, WILLIAM
				Check				Tested with LabVIEW, saved data files to server.
				MISJOB# 58865	/79101	02/18/2005	COMPLETED	BARKER, WILLIAM
				Install ECO				Replaced sync input resistor.
Ptag #: 570235 04/05/2005	sn: 201 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58335	/78126	01/26/2005	COMPLETED	BARKER, WILLIAM
				Check				Tested with LabVIEW, saved data files to server.
				MISJOB# 58865	/79102	02/18/2005	COMPLETED	BARKER, WILLIAM
				Install ECO				Replaced sync input resistor.

F4-SERV

Ptag #: 570294 04/05/2005	sn: 260 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58382	/78240	01/31/2005	COMPLETED	BARKER, WILLIAM
				check				Tested with LabVIEW, saved data files to server.
				MISJOB# 58878	/79216	02/18/2005	COMPLETED	BARKER, WILLIAM
				check				Replaced sync input resistor.
Ptag #: 570309 04/05/2005	sn: 250 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58382	/78239	01/27/2005	COMPLETED	BARKER, WILLIAM
				check				Tested with LabVIEW, saved data files to server.
				MISJOB# 58865	/79127	02/18/2005	COMPLETED	BARKER, WILLIAM
				Install ECO				Replaced sync input resistor.
Ptag #: 570310 04/05/2005	sn: 252 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58382	/78224	01/27/2005	COMPLETED	BARKER, WILLIAM
				check				Tested with LabVIEW, saved data files to server.
				MISJOB# 58865	/79128	02/18/2005	COMPLETED	BARKER, WILLIAM
				Install ECO				Replaced sync input resistor.
Ptag #: 570319 04/05/2005	sn: 243 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58450	/78357	02/01/2005	COMPLETED	BARKER, WILLIAM
				check				Tested with LabVIEW, saved data files to server.
				MISJOB# 58865	/79135	02/18/2005	COMPLETED	BARKER, WILLIAM
				Install ECO				Replaced sync input resistor.
Ptag #: 570320 04/05/2005	sn: 200 ISSUED TO USER	OLSON	FL/AD	MISJOB# 58450	/78358	02/01/2005	COMPLETED	BARKER, WILLIAM
				check				Tested with LabVIEW, saved data files to server.
				MISJOB# 58865	/79136	02/18/2005	COMPLETED	BARKER, WILLIAM
				Install ECO				Replaced sync input resistor.

FCC/3/331

Ptag #: 568875 08/24/2004	sn: 023 ISSUED TO USER		FL/CD/CEP/ESE					
Ptag #: 568963 09/30/2004	sn: 028 ISSUED TO USER	PICCOLI	FL/CD/CEP/OAA	MISJOB# 57777	/77189	09/29/2004	COMPLETED	MAHLUM, RICHARD
				check				tested with Labview and saved data files.
Ptag #: 568968 09/29/2004	sn: 050 ISSUED TO USER	PICCOLI	FL/CD/CEP/OAA	MISJOB# 57776	/77178	09/29/2004	COMPLETED	MAHLUM, RICHARD
				check				tested with Labview and saved data files.
Ptag #: 568974 09/29/2004	sn: 033 ISSUED TO USER	PICCOLI	FL/CD/CEP/OAA	MISJOB# 57776	/77184	09/29/2004	COMPLETED	MAHLUM, RICHARD
				check				tested

Ptag #: 569001		sn: 105		FL/CD/CSS/ESS	MISJOB# 58278 /77993	11/24/2004	CANCELED BY ESS	
01/18/2005	ISSUED TO USER	CANCELO			Install new firmware			
					MISJOB# 57924 /77431 check	10/25/2004	COMPLETED	MAHLUM, RICHARD tested and saved data files.
					MISJOB# 58278 /77983 Install new firmware	12/17/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. retests ok.
Ptag #: 569002		sn: 098		FL/CD/CEP/ESE	MISJOB# 58278 /77994	11/24/2004	CANCELED BY ESS	
01/18/2005	ISSUED TO USER	CANCELO			Install new firmware			
					MISJOB# 57924 /77432 check	10/25/2004	COMPLETED	MAHLUM, RICHARD tested and saved data files.
					MISJOB# 58278 /77984 Install new firmware	12/17/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. retests ok.
Ptag #: 569004		sn: 053		FL/CD/CEP/OAA	MISJOB# 57924 /77434 check	10/27/2004	COMPLETED	MAHLUM, RICHARD tested and saved data files
11/15/2004	ISSUED TO USER	ZHANG						
Ptag #: 569024		sn: 074		FL/CD/CEP/ESE	MISJOB# 57924 /77454 check	12/09/2004 factory found sort on UE2	COMPLETED	MAHLUM, RICHARD chl 4 has bad DNL Rcvd 12/2/04 Retested Ok saved data files to servers.
03/03/2005	ISSUED TO USER	HAYNES			MISJOB# 58878 /79196 check	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 569025		sn: 097		FL/CD/CEP/ESE	MISJOB# 57924 /77455 check	10/21/2004	COMPLETED	MAHLUM, RICHARD tests ok with Labview program. saved data files to Diags\Echotek
01/18/2005	ISSUED TO USER	CANCELO			MISJOB# 58278 /78006 Install new firmware	12/17/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. retests ok.
Ptag #: 569026		sn: 072		FL/CD/CEP/ESE	MISJOB# 57924 /77456 check	10/21/2004	COMPLETED	MAHLUM, RICHARD tests ok with Labview program. saved data files to Diags\Echotek
01/18/2005	ISSUED TO USER	CANCELO			MISJOB# 58278 /78007 Install new firmware	12/17/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. retests ok.
Ptag #: 569136		sn: 183		FL/CD/CEP/OAA	MISJOB# 58238 /77907 run tests	12/27/2004	COMPLETED	MAHLUM, RICHARD tested with Labview. saved data files to server.
05/23/2005	ISSUED TO USER	BIERY			MISJOB# 58910 /79332 Install ECO	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.

Ptag #:	569006	sn: 090	01/26/2005	ISSUED TO USER	BLED SOE	FL/CD/CSS/ESS	MISJOB# 58278 /77996	11/24/2004	CANCELED BY ESS	
							Install new firmware			
							MISJOB# 57924 /77436	10/21/2004	COMPLETED	MAHLUM, RICHARD tests ok with Labview program. saved data files to Diags\Echotek
							MISJOB# 58278 /77986	12/20/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. retests ok.
							MISJOB# 58238 /77901	01/13/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.

LIG

Ptag #:	569073	sn: 131	04/27/2005	ISSUED TO USER	PRIETO	FL/AD/ENG/INST	MISJOB# 58040 /77633	12/04/2004	COMPLETED	MAHLUM, RICHARD
							check	Dehong looked at possible problems but found none.		reprogrammed firmware. tested and saved data files.
							MISJOB# 58878 /79204	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.

TGC

Ptag #:	569134	sn: 190	02/11/2005	ISSUED TO USER	PRIETO	FL/AD	MISJOB# 58238 /77905	01/12/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
							MISJOB# 58817 /79036	02/10/2005	COMPLETED	BLED SOE, STEWART Removed and replaced R242 with a 50 ohm 0402 resistor.
Ptag #:	570311	sn: 245	02/18/2005	ISSUED TO USER	EDDY	FL/AD	MISJOB# 58382 /78225	01/28/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
							MISJOB# 58865 /79129	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #:	570312	sn: 215	02/18/2005	ISSUED TO USER	EDDY	FL/AD	MISJOB# 58382 /78226	01/28/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server. Replaced broken upper latch habdle.
							MISJOB# 58865 /79130	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.

XGALLERY

Ptag #: 569135 sn: 187								
05/02/2005	ISSUED TO USER	EDDY	FL/AD	MISJOB# 58238 /77906	01/12/2005	COMPLETED	BARKER, WILLIAM	
				run tests			Tested with LabVIEW, saved data files to server.	
				MISJOB# 58817 /79037	02/10/2005	COMPLETED	BLEDSON, STEWART	
				install eoc			Removed and replaced R242 with a 50 ohm 0402 resistor.	
				MISJOB# 59174 /79759	05/02/2005	COMPLETED	BARKER, WILLIAM	
				Causes interrupts on VME Bus	NPF		Tested with LabVIEW, saved data files to server. Ken Treptow verified that this locks up the system & pulls interrupts on the VMEBus. He requests it be returned to vendor for repair.	
							4/29/05 - Tested with LabVIEW, saved data files to server.	

Ptag #: 568873 sn: 021 05/20/2005 READY FOR ISSUE	MISJOB# 59567 /80333 Check	05/20/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
Ptag #: 568874 sn: 022 04/07/2005 READY FOR ISSUE	MISJOB# 58952 /79410 will not upload firmware, install sync eco, run labview tests	04/07/2005	COMPLETED	BARKER, WILLIAM LabVIEW tested, saved data files to server
Ptag #: 568876 sn: 024 05/04/2005 READY FOR ISSUE	MISJOB# 59439 /80149 needs trigger input 50-2? termination	05/04/2005	COMPLETED	BARKER, WILLIAM Replaced R242, a 1Kohm 1/16W sync input resistor, with 50ohm 1/16W resistor.
Ptag #: 568969 sn: 032 05/20/2005 READY FOR ISSUE	MISJOB# 57776 /77179 check	12/13/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. retested ok. saved data files.
	MISJOB# 58908 /79275 Install ECO	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
	MISJOB# 59567 /80334 Check	05/20/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
Ptag #: 568971 sn: 045 05/20/2005 READY FOR ISSUE	MISJOB# 57776 /77181 check	09/29/2004	COMPLETED	MAHLUM, RICHARD tested
	MISJOB# 59567 /80335 Check	05/20/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
Ptag #: 568973 sn: 0036 02/16/2005 READY FOR ISSUE	MISJOB# 57776 /77183 check	09/29/2004	COMPLETED	MAHLUM, RICHARD tested with Labview and saved data files.
	MISJOB# 58337 /78103 Ch. 6 is suspect. (Exchange for PRAR?# 569045)	02/01/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
	MISJOB# 58865 /79089 Install ECO	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 568979 sn: 073 02/18/2005 READY FOR ISSUE	MISJOB# 57831 /77288 check	10/07/2004	COMPLETED	MAHLUM, RICHARD tested with Labview and saved data files.
	MISJOB# 58278 /77967 Install new firmware	12/16/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. retests ok.
	MISJOB# 58878 /79172 check	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.

Ptag #: 568981 sn: 029 05/03/2005 READY FOR ISSUE	MISJOB# 57831 /77290	05/04/2005	COMPLETED	BARKER, WILLIAM chl 2 fails DNL LabVIEW tested, saved data files to server; same problem after vendor return - 02-MAR-05. After some additional testing of the two Echotek boards that failed the differential non-linearity test, the conclusions are; 1) there are NO missing codes 2) there are NO code flips 3) "dropouts" in the data acquisition when using the Labview program are due to network timeouts, not an Echotek problem 4) the non-linearity appears to be strictly due to varying bin width at certain code intervals (e.g., every 2^512 codes for SN 029, channel 2) in the ADCs Although these channels fail the +/-0.75 linearity requirement in the test, they are within the Analog Devices specification for the converter (-1.0, +1.5). My recommendation is that the two boards currently on hold for non-linearity test failure (SN062, SN029) be accepted.
	check			
Ptag #: 568983 sn: 081 02/22/2005 READY FOR ISSUE	MISJOB# 57831 /77292	10/06/2004	COMPLETED	MAHLUM, RICHARD tested with Labview and saved data files.
	check			
	MISJOB# 58278 /77969	12/17/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. retests ok.
Ptag #: 568991 sn: 077 02/18/2005 READY FOR ISSUE	MISJOB# 58910 /79290	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
	Install ECO			
	MISJOB# 57831 /77300	10/18/2004	COMPLETED	MAHLUM, RICHARD low gain on 7 all chls pass after adjusting the limits in the Labview program
	check			
	MISJOB# 58278 /77974	12/16/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. retests ok.
	Install new firmware			
	MISJOB# 58878 /79177	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
	check			

Ptag #: 569003 04/29/2005 READY FOR ISSUE	sn: 096	MISJOB# 57924 /77433 check	10/27/2004	COMPLETED	MAHLUM, RICHARD tested and saved data files
		MISJOB# 58979 /79465 of led does not turn off after reset	05/02/2005	COMPLETED	BARKER, WILLIAM System won't boot. 4/29/05 - Tested with LabVIEW, saved data files to server.
Ptag #: 569005 02/22/2005 READY FOR ISSUE	sn: 068	MISJOB# 58278 /77995 Install new firmware	11/24/2004	CANCELED BY ESS	
		MISJOB# 57924 /77435 check	10/21/2004	COMPLETED	MAHLUM, RICHARD tests ok with Labview program. saved data files to Diags\Echotek
		MISJOB# 58278 /77985 Install new firmware	12/20/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. retests ok.
		MISJOB# 58908 /79283 Install ECO	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 569007 02/18/2005 READY FOR ISSUE	sn: 083	MISJOB# 58278 /77997 Install new firmware	11/24/2004	CANCELED BY ESS	
		MISJOB# 57924 /77437 check	10/21/2004	COMPLETED	MAHLUM, RICHARD tests ok with Labview program. saved data files to Diags\Echotek
		MISJOB# 58278 /77987 Install new firmware	12/16/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. retests ok.
		MISJOB# 58878 /79186 check	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.

Ptag #: 569009 sn: 062 05/03/2005 READY FOR ISSUE	MISJOB# 57924 /77439	05/04/2005	COMPLETED	<p>BARKER, WILLIAM</p> <p>bad DNL on ch 1</p> <p>LabVIEW tested, saved data files to server; same problem after vendor return - 02-MAR-05.</p> <p>After some additional testing of the two Echotek boards that failed the differential non-linearity test, the conclusions are;</p> <p>1) there are NO missing codes</p> <p>2) there are NO code flips</p> <p>3) "dropouts" in the data acquisition when using the Labview program are due to network timeouts, not an Echotek problem</p> <p>4) the non-linearity appears to be strictly due to varying bin width at certain code intervals (e.g., every 2⁵12 codes for SN 029, channel 2) in the ADCs</p> <p>Although these channels fail the +/-0.75 linearity requirement in the test, they are within the Analog Devices specification for the converter (-1.0, +1.5).</p> <p>My recommendation is that the two boards currently on hold for non-linearity test failure (SN062, SN029) be accepted.</p>
	check			
Ptag #: 569010 sn: 078 04/04/2005 READY FOR ISSUE	MISJOB# 57924 /77440	10/21/2004	COMPLETED	<p>MAHLUM, RICHARD</p> <p>tests ok with Labview program.</p> <p>saved data files to Diags\Echotek</p>
	check			
	MISJOB# 58278 /77998	12/17/2004	COMPLETED	<p>MAHLUM, RICHARD</p> <p>reprogrammed firmware.</p> <p>retests ok.</p>
	Install new firmware			
	MISJOB# 58878 /79187	02/18/2005	COMPLETED	<p>BARKER, WILLIAM</p> <p>Replaced sync input resistor.</p>
	check			
	MISJOB# 59182 /79767	04/07/2005 NPF	COMPLETED	<p>BARKER, WILLIAM</p> <p>In the field (C2), when SW was attempting to set a specific channel, the part of the SW that sets channels would hang. Luciano tested it in his teststand at FCC w/o problem, but wishes these to be flagged somehow incase it happens again. Tested with LabVIEW, saved data files to server.</p>
	Check			

Ptag #: 569011 02/18/2005 READY FOR ISSUE	sn: 086	MISJOB# 57924 /77441 check	10/21/2004	COMPLETED	MAHLUM, RICHARD tests ok with Labview program. saved data files to Diags\Echotek
		MISJOB# 58278 /77999 Install new firmware	12/16/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. retests ok.
		MISJOB# 58878 /79188 check	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 569019 05/13/2005 READY FOR ISSUE	sn: 066	MISJOB# 57924 /77449 check	10/15/2004	COMPLETED	MAHLUM, RICHARD ch 3 low gain With the program's gain limits adjusted it now passes. Data files saved.
		MISJOB# 58278 /78003 Install new firmware	12/17/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. retests ok.
		MISJOB# 58878 /79193 check	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
		MISJOB# 59404 /80061 ch8 bad; reads 0	05/13/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server. Burned in overnight with no problem.
Ptag #: 569023 02/18/2005 READY FOR ISSUE	sn: 112	MISJOB# 57924 /77453 check	10/21/2004	COMPLETED	MAHLUM, RICHARD tests ok . saved data files.
		MISJOB# 58319 /78059 check	12/17/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. retests ok.
		MISJOB# 58878 /79195 check	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 569028 02/18/2005 READY FOR ISSUE	sn: 113	MISJOB# 57924 /77458 check	10/21/2004	COMPLETED	MAHLUM, RICHARD tests ok . saved data files.
		MISJOB# 58278 /78009 Install new firmware	12/17/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. retests ok.
		MISJOB# 58878 /79198 check	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 569033 02/22/2005 READY FOR ISSUE	sn: 136	MISJOB# 57994 /77534 check	12/03/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested and saved data files.
		MISJOB# 58910 /79293 Install ECO	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 569034 02/22/2005 READY FOR ISSUE	sn: 140	MISJOB# 57994 /77535 check	12/03/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested and saved data files.
		MISJOB# 58910 /79294 Install ECO	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.

Ptag #: 569041 05/13/2005 READY FOR ISSUE	sn: 153	MISJOB# 57994 check	/77542	11/15/2004	COMPLETED	MAHLUM, RICHARD reprogrammed with latest firmware. tested and collected data files.
		MISJOB# 59404 ch8 bad; reads 0	/80062	05/13/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server. Burned in overnight with no problem.
Ptag #: 569043 02/22/2005 READY FOR ISSUE	sn: 123	MISJOB# 57994 check	/77544	12/02/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested and saved data files.
		MISJOB# 58910 Install ECO	/79297	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 569044 02/22/2005 READY FOR ISSUE	sn: 109	MISJOB# 57994 check	/77545	12/02/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested and saved data files.
		MISJOB# 58910 Install ECO	/79298	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 569046 02/22/2005 READY FOR ISSUE	sn: 156	MISJOB# 57994 check	/77547	12/01/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested and saved data files.
		MISJOB# 58910 Install ECO	/79299	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 569047 02/22/2005 READY FOR ISSUE	sn: 122	MISJOB# 57994 check	/77548	11/30/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested and saved data files.
		MISJOB# 58910 Install ECO	/79300	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 569048 02/22/2005 READY FOR ISSUE	sn: 128	MISJOB# 57994 check	/77549	11/30/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested and saved data files.
		MISJOB# 58910 Install ECO	/79301	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 569051 05/20/2005 READY FOR ISSUE	sn: 138	MISJOB# 57994 check	/77552	12/01/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested and saved data files.
		MISJOB# 59567 Check	/80336	05/20/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
Ptag #: 569052 05/20/2005 READY FOR ISSUE	sn: 129	MISJOB# 57994 check	/77553	12/01/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested and saved data files.
		MISJOB# 59567 Check	/80337	05/20/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
Ptag #: 569053 05/20/2005 READY FOR ISSUE	sn: 135	MISJOB# 57994 check	/77554	12/01/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested and saved data files.
		MISJOB# 59567 Check	/80338	05/20/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.

Ptag #: 569054 sn: 126 05/20/2005 READY FOR ISSUE	MISJOB# 57994	/77555	12/01/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested and saved data files.
	check				
	MISJOB# 59567	/80339	05/20/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
	Check				
Ptag #: 569056 sn: 150 04/04/2005 READY FOR ISSUE	MISJOB# 57994	/77557	11/22/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested and saved data files.
	check				
	MISJOB# 59182	/79766	04/07/2005 NPF	COMPLETED	BARKER, WILLIAM In the field (C3), when SW was attempting to set a specific channel, the part of the SW that sets channels would hang. Luciano tested it in his teststand at FCC w/o problem, but weishes these to be flagged somehow incase it happens again. Tested with LabVIEW, saved data files to server.
	Check				
Ptag #: 569057 sn: 092 02/22/2005 READY FOR ISSUE	MISJOB# 57994	/77558	11/29/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested and saved data files.
	check				
	MISJOB# 58910	/79302	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
	Install ECO				
Ptag #: 569074 sn: 064 02/22/2005 READY FOR ISSUE	MISJOB# 58040	/77634	11/29/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested and saved data files.
	check				
	MISJOB# 58910	/79305	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
	Install ECO				
Ptag #: 569077 sn: 084 02/22/2005 READY FOR ISSUE	MISJOB# 58041	/77637	11/29/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested and saved data files.
	check				
	MISJOB# 58910	/79308	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
	Install ECO				
Ptag #: 569078 sn: 099 02/22/2005 READY FOR ISSUE	MISJOB# 58041	/77638	11/29/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested and saved data files.
	check				
	MISJOB# 58910	/79309	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
	Install ECO				
Ptag #: 569079 sn: 163 02/22/2005 READY FOR ISSUE	MISJOB# 58041	/77639	11/24/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested and saved data files.
	check				
	MISJOB# 58910	/79310	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
	Install ECO				
Ptag #: 569080 sn: 166 02/22/2005 READY FOR ISSUE	MISJOB# 58041	/77640	11/24/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested and saved data files.
	check				
	MISJOB# 58910	/79311	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
	Install ECO				

Ptag #: 569081 sn: 088 02/22/2005 READY FOR ISSUE	MISJOB# 58041	/77641	11/30/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested and saved data files.
	MISJOB# 58910 Install ECO	/79312	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 569082 sn: 137 02/22/2005 READY FOR ISSUE	MISJOB# 58041	/77642	11/30/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested and saved data files.
	MISJOB# 58910 Install ECO	/79313	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 569085 sn: 118 02/22/2005 READY FOR ISSUE	MISJOB# 58042	/77645	11/30/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested and saved data files.
	MISJOB# 58910 Install ECO	/79316	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 569092 sn: 108 04/29/2005 READY FOR ISSUE	MISJOB# 58042	/77652	05/02/2005	COMPLETED	BARKER, WILLIAM chl 4 fails DNL even after reprogramming the firmware. Missing bit. LabVIEW tested, saved data files to server; same problem after vendor return - 02-MAR-05. 4/29/05 - Tested with LabVIEW, saved data files to server.
Ptag #: 569097 sn: 161 04/07/2005 READY FOR ISSUE	MISJOB# 58086	/77706	04/07/2005	COMPLETED	BARKER, WILLIAM LabVIEW tested, saved data files to server.
Ptag #: 569107 sn: 120 02/22/2005 READY FOR ISSUE	MISJOB# 58085	/77702	11/24/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested and saved data files.
	MISJOB# 58910 Install ECO	/79321	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 569108 sn: 143 02/22/2005 READY FOR ISSUE	MISJOB# 58085	/77703	11/24/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested and saved data files.
	MISJOB# 58910 Install ECO	/79322	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 569109 sn: 172 02/22/2005 READY FOR ISSUE	MISJOB# 58085	/77704	11/24/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested and saved data files.
	MISJOB# 58910 Install ECO	/79323	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 569110 sn: 146 02/22/2005 READY FOR ISSUE	MISJOB# 58085	/77705	11/24/2004	COMPLETED	MAHLUM, RICHARD reprogrammed firmware. tested and saved data files.
	MISJOB# 58910 Install ECO	/79324	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.

Ptag #: 569125 02/22/2005 READY FOR ISSUE	sn: 192	MISJOB# 58238	/77896	01/13/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
		run tests				
		MISJOB# 58910	/79325	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
		Install ECO				
Ptag #: 569126 02/22/2005 READY FOR ISSUE	sn: 177	MISJOB# 58238	/77897	01/13/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
		run tests				
		MISJOB# 58910	/79326	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
		Install ECO				
Ptag #: 569129 01/13/2005 READY FOR ISSUE	sn: 195	MISJOB# 58238	/77900	01/13/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
		run tests				
Ptag #: 569137 02/22/2005 READY FOR ISSUE	sn: 182	MISJOB# 58238	/77908	12/27/2004	COMPLETED	MAHLUM, RICHARD tested with Labview. saved data files to server.
		run tests				
		MISJOB# 58910	/79333	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
		Install ECO				
Ptag #: 569142 02/22/2005 READY FOR ISSUE	sn: 189	MISJOB# 58238	/77913	01/05/2005	COMPLETED	MAHLUM, RICHARD tested and saved data files.
		run tests				
		MISJOB# 58910	/79336	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
		Install ECO				
Ptag #: 569143 02/22/2005 READY FOR ISSUE	sn: 197	MISJOB# 58238	/77914	01/05/2005	COMPLETED	MAHLUM, RICHARD tested and saved data files.
		run tests				
		MISJOB# 58910	/79337	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
		Install ECO				
Ptag #: 569144 02/22/2005 READY FOR ISSUE	sn: 175	MISJOB# 58238	/77915	12/27/2004	COMPLETED	MAHLUM, RICHARD tested with Labview. saved data files to server.
		run tests				
		MISJOB# 58910	/79338	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
		Install ECO				
Ptag #: 569145 02/22/2005 READY FOR ISSUE	sn: 176	MISJOB# 58238	/77916	12/27/2004	COMPLETED	MAHLUM, RICHARD tested with Labview. saved data files to server.
		run tests				
		MISJOB# 58910	/79339	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
		Install ECO				
Ptag #: 570224 02/16/2005 READY FOR ISSUE	sn: 213	MISJOB# 58335	/78131	01/27/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
		Check				
		MISJOB# 58865	/79092	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
		Install ECO				
Ptag #: 570225 02/16/2005 READY FOR ISSUE	sn: 248	MISJOB# 58335	/78132	01/27/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
		Check				
		MISJOB# 58865	/79093	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
		Install ECO				
Ptag #: 570228 02/16/2005 READY FOR ISSUE	sn: 239	MISJOB# 58335	/78135	01/27/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
		Check				
		MISJOB# 58865	/79096	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
		Install ECO				

Ptag #: 570229 02/16/2005 READY FOR ISSUE	sn: 223	MISJOB# 58335	/78136	01/27/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
		MISJOB# 58865	/79097	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 570230 02/16/2005 READY FOR ISSUE	sn: 238	MISJOB# 58335	/78121	01/26/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
		MISJOB# 58865	/79098	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 570238 02/18/2005 READY FOR ISSUE	sn: 193	MISJOB# 58335	/78094	01/18/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
		MISJOB# 58878	/79205	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 570239 02/18/2005 READY FOR ISSUE	sn: 178	MISJOB# 58335	/78095	01/18/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
		MISJOB# 58878	/79206	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 570240 02/18/2005 READY FOR ISSUE	sn: 199	MISJOB# 58335	/78096	01/18/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
		MISJOB# 58878	/79207	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 570241 02/18/2005 READY FOR ISSUE	sn: 208	MISJOB# 58335	/78097	01/18/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
		MISJOB# 58878	/79208	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 570242 02/23/2005 READY FOR ISSUE	sn: 205	MISJOB# 58335	/78098	01/18/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
		MISJOB# 58919	/79351	02/25/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 570243 02/23/2005 READY FOR ISSUE	sn: 180	MISJOB# 58335	/78099	01/18/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
		MISJOB# 58919	/79352	02/25/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 570244 02/23/2005 READY FOR ISSUE	sn: 202	MISJOB# 58335	/78100	01/20/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
		MISJOB# 58919	/79353	02/25/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 570245 02/23/2005 READY FOR ISSUE	sn: 249	MISJOB# 58335	/78112	01/20/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
		MISJOB# 58919	/79354	02/25/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 570246 02/18/2005 READY FOR ISSUE	sn: 236	MISJOB# 58335	/78101	01/20/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
		MISJOB# 58878	/79209	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.

Ptag #: 570247 sn: 212 02/18/2005 READY FOR ISSUE	MISJOB# 58335	/78105	01/20/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
	MISJOB# 58878	/79210	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 570248 sn: 196 02/23/2005 READY FOR ISSUE	MISJOB# 58335	/78106	01/20/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
	MISJOB# 58919	/79355	02/25/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 570249 sn: 188 02/23/2005 READY FOR ISSUE	MISJOB# 58335	/78107	01/20/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
	MISJOB# 58919	/79356	02/25/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 570250 sn: 235 02/18/2005 READY FOR ISSUE	MISJOB# 58335	/78108	01/26/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
	MISJOB# 58878	/79211	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 570251 sn: 222 02/18/2005 READY FOR ISSUE	MISJOB# 58335	/78109	01/26/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
	MISJOB# 58878	/79212	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 570252 sn: 227 02/23/2005 READY FOR ISSUE	MISJOB# 58335	/78110	01/26/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
	MISJOB# 58919	/79357	02/25/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 570253 sn: 214 02/23/2005 READY FOR ISSUE	MISJOB# 58335	/78111	01/26/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
	MISJOB# 58919	/79358	02/25/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 570254 sn: 207 02/16/2005 READY FOR ISSUE	MISJOB# 58335	/78113	01/26/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
	MISJOB# 58865	/79105	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 570255 sn: 226 02/16/2005 READY FOR ISSUE	MISJOB# 58335	/78114	01/26/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
	MISJOB# 58865	/79106	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 570258 sn: 229 02/16/2005 READY FOR ISSUE	MISJOB# 58335	/78117	01/26/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
	MISJOB# 58865	/79109	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 570259 sn: 217 02/16/2005 READY FOR ISSUE	MISJOB# 58335	/78118	01/26/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
	MISJOB# 58865	/79110	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.

Ptag #: 570263 02/18/2005 READY FOR ISSUE	sn: 237	MISJOB# 58335	/78087	01/13/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
		MISJOB# 58878	/79213	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 570264 02/22/2005 READY FOR ISSUE	sn: 234	MISJOB# 58335	/78088	01/18/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
		MISJOB# 58910	/79340	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 570265 02/22/2005 READY FOR ISSUE	sn: 211	MISJOB# 58335	/78089	01/18/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
		MISJOB# 58910	/79341	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 570266 02/18/2005 READY FOR ISSUE	sn: 233	MISJOB# 58335	/78090	01/18/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
		MISJOB# 58878	/79214	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 570267 02/18/2005 READY FOR ISSUE	sn: 216	MISJOB# 58335	/78091	01/18/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
		MISJOB# 58878	/79215	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 570295 02/23/2005 READY FOR ISSUE	sn: 267	MISJOB# 58382	/78241	01/31/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
		MISJOB# 58919	/79359	02/25/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 570296 02/23/2005 READY FOR ISSUE	sn: 203	MISJOB# 58382	/78242	01/31/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
		MISJOB# 58919	/79360	02/25/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 570297 02/16/2005 READY FOR ISSUE	sn: 269	MISJOB# 58382	/78243	01/31/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
		MISJOB# 58865	/79116	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 570298 02/16/2005 READY FOR ISSUE	sn: 241	MISJOB# 58382	/78244	01/31/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
		MISJOB# 58865	/79117	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 570299 02/16/2005 READY FOR ISSUE	sn: 275	MISJOB# 58382	/78245	01/31/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
		MISJOB# 58865	/79118	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 570300 02/16/2005 READY FOR ISSUE	sn: 257	MISJOB# 58382	/78246	01/31/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
		MISJOB# 58865	/79119	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.

Ptag #: 570301 02/18/2005 READY FOR ISSUE	sn: 256	MISJOB# 58382	/78247	01/31/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
		MISJOB# 58878	/79217	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 570302 02/18/2005 READY FOR ISSUE	sn: 272	MISJOB# 58382	/78232	01/31/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
		MISJOB# 58878	/79218	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 570303 02/16/2005 READY FOR ISSUE	sn: 240	MISJOB# 58382	/78233	02/01/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
		MISJOB# 58865	/79120	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 570304 02/16/2005 READY FOR ISSUE	sn: 255	MISJOB# 58382	/78234	02/01/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
		MISJOB# 58865	/79121	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 570307 02/16/2005 READY FOR ISSUE	sn: 251	MISJOB# 58382	/78237	02/01/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
		MISJOB# 58865	/79125	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 570308 02/16/2005 READY FOR ISSUE	sn: 263	MISJOB# 58382	/78238	02/01/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
		MISJOB# 58865	/79126	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 570313 02/18/2005 READY FOR ISSUE	sn: 262	MISJOB# 58382	/78227	01/28/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
		MISJOB# 58865	/79131	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 570314 02/18/2005 READY FOR ISSUE	sn: 225	MISJOB# 58382	/78228	01/28/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
		MISJOB# 58865	/79132	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 570315 02/18/2005 READY FOR ISSUE	sn: 261	MISJOB# 58382	/78229	01/28/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
		MISJOB# 58865	/79133	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 570316 02/18/2005 READY FOR ISSUE	sn: 258	MISJOB# 58382	/78230	01/28/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
		MISJOB# 58865	/79134	02/18/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.
Ptag #: 570317 02/22/2005 READY FOR ISSUE	sn: 259	MISJOB# 58382	/78231	02/01/2005	COMPLETED	BARKER, WILLIAM Tested with LabVIEW, saved data files to server.
		MISJOB# 58909	/79286	02/23/2005	COMPLETED	BARKER, WILLIAM Replaced sync input resistor.

Ptag #: 570318 sn: 253		MISJOB# 58382 /78223	02/01/2005	COMPLETED	BARKER, WILLIAM
02/22/2005	READY FOR ISSUE	check			Tested with LabVIEW, saved data files to server.
		MISJOB# 58909 /79287	02/23/2005	COMPLETED	BARKER, WILLIAM
		install ECO			Replaced sync input resistor.